## - Site Service Report -

Date:June 9, 2009

IRD SO.: 10407 A IRD Contract No.:

From: Tim Weber To: ESS

State: Illinois

Project Name/Location: I-57 Tuscola NB

Service Date(s): May 2, 2008

Job Description: Replace rubber strips.

## **Work Completed:**

We removed old silicone that was around the nuts. We removed the nuts and washers. We lifted up the load bars. John wire brushed the frame and bars. Then he vacuumed out the frame. I added a bead of silicone to the bars and then attached the new orange strip. I anti-seized the BP edge and the bolts. I lowered the bars in place and then stepped on them to make sure they were seated right. I installed new spring washers and lock nuts. John tightened the nuts to 90 PSI. He then filled in the holes with silicone.

I stepped on the plates in each corner and the plates didn't move. I then logged into the software and watched vehicles in diagnostic mode for a while. Everything looked good. I switched over to normal view and it still looked good. I listened to the plates and they weren't making any noise.

Work Remaining: None.

Parts Used: 4 orange rubber strips, 24 spring washers, and 24 lock nuts.

Mileage: 200 miles.

Hours Worked: 3 hours driving, 1 hour onsite X 2 = 8 hours total.

## Notes:

## Action Items:

Item	Action Required	Ownership
1.		
2.		
3.		
4.		

6/19/96 IRD FORM No.: 1304A